

SERVICE BULLETIN

SEGA Service Department 45133 Industrial Drive Fremont, Ca. 94538 http://www.seuservice.com Phone: 415.701.6580 Fax: 415.701.6594

Feb. 15, 2000



FOR ALL BASS
FISHING U/R
GAMES

Problem: Reel encoder becomes disfunctional.

Cause: Excessive static being discharged into control handle can damage encoder.

Solution: To help control this, a second ground wire (18 guage) can be added to the handle assy

(see diagram below). Also, the use of an extension cord for main power should be avoided. The outlet that the machine is plugged into needs to be properly grounded, use Recepticle (plug polarity) Tester to verify. (Grainger Part No. 3T885) *or equivalent*.

