



SERVICE BULLETIN

SEGA Service Department
45133 Industrial Drive
Fremont, Ca. 94538

<http://www.segasevice.com>
Phone: 415.701.6580
Fax: 415.701.6594

This is to notify you of a problem concerning the 'I/O BD JVS to JAMMA' on the following Game kits; World Series 99', Zombie Revenge, VS 2000

PROBLEM: Sometimes the game will not credit though the coinmeter works normally. Alternately coin meter sometimes counts up during power up.

NOTE: These problems only occurred with BD# 838-13683-92 only, and PCB marked "SDC-1" only (There are two vendors for this PCB). If your Board says "AUTO-10" please disregard this bulletin.

SOLUTION: Make sure the PCB is marked "SDC-1" (Not "AUTO-10"). Cut PCB Pattern. (Near the IC8, 2 pos. shown below in detail)

WARNING: This procedure is to be performed by an experienced PCB technician. Failure to heed this warning may cause irreparable/unwarranted damage to your Board.



NEW VIEW ON NEXT PAGE

Location of paths that need to be severed

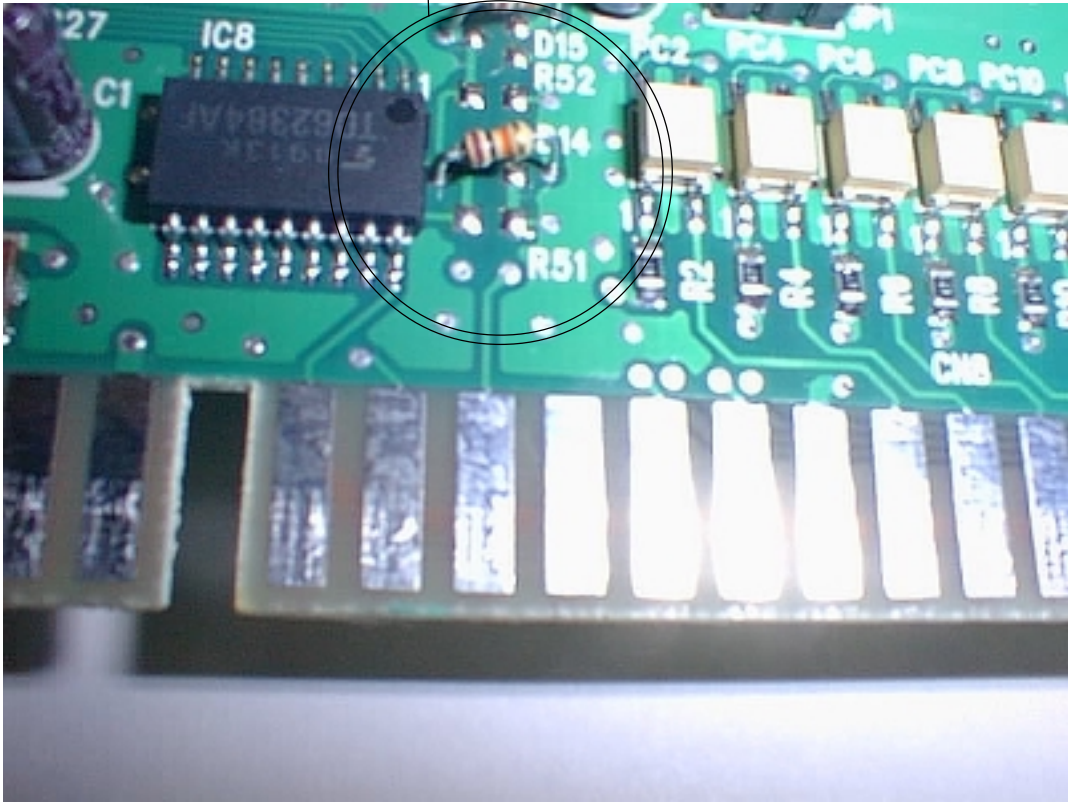


Image of area in question with indication of suggested location of cuts to paths

